
 


DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
TOTALS brought forward from previous page				
		TSN <u>8059.1</u> TSO <u>2143.9</u>	CSN <u>7936</u> CSO <u>2413</u>	
05/23/07				
	PCE 85203			
				1. Disassembled the Power Section to inspect. Cleaned, inspected, repaired as necessary and reassembled with overhauled bearings. PT Disks were repaired at Prime Turbines under their WO W28577. Prime Turbines also inspected parts under their WO 028577. PT Vane PN 3030262 SN 6L387 was overhauled at Sifco Turbine Component Services under their WO 052075. Balanced the first stage carrier and power turbine assembly.
				2. Installed overhauled Overspeed Governor PN 210638F SN 1990996 and overhauled prop governor PN 8210-007G SN 1755333.
				All work done PER P&W OH Manual PN 3021443 Rev. 39. See WO 002119 on file at Dynamic Aviation for details. See FAA FORM 337 this date.
				 Allen LaBonte A&P 57549194

PCE 85203 GG	Date 05/23/07	TSN 7834.8 CSN 7680	TSO 1919.6 CSO 2157	HSI 0.0	Installed the following components: OH FCU P/N 3244755-22-21 S/N A77914, OH LP Compressor Bleed Valve P/N 3100923-02 S/N 3K036, OH HP Compressor Bleed Valve P/N 3100922-05 S/N 8E408 All work performed IAW P&W Maintenance Manual P/N 3021442 Rev 40. Remaining details of work accomplished can be found under WO # 3612. Allen L. LaBonte A&P 57549194
PCE 85203 PS	Date 05/23/07	TSN 8059.1 CSN 7936	TSO 2143.9 CSO 2413		
SUB-TOTALS this page					
TOTALS -Carry forward to next page					

